

Order-No.: DD+DIS050.00E


1 Piece QKV10 MA1

February 2000

ADC Solo Type 5155

Introduction of the


Modification Kit "Opener Spring" at the Side Wall of the Cassette Unit

The installation of the "opener spring" must be carried out on all ADC Solo digitizers:

Classification			When?		
Safety relevant	Reliability	New function	Immediately	Next service	As required
	X			X	

Problem

The lid of the cassette cannot be opened.
Although an IP is inside the cassette, the error message **22D40** is displayed:
Meaning of 22D40: *User Fault, Input of cassette without IP in Input buffer.*
The user is requested to remove the cassette and insert an IP.

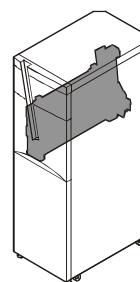

Reason

The pawl of the swivel plate cannot take hold of the lid during the opening process. The lid remains closed. The IP transport unit moves up and the suction cups try unsuccessfully to suck on the lid, which causes the error message.

Solution

Installation of a return spring at the side wall of the cassette unit in order to draw back the pawl of the swivel plate to its home position.

Order Number

Modification kit "opener spring":

CM+9.5155.9210.0

Scope of Delivery

- 1 x return spring (greased leg spring)
- 1 x screw (hexagon head 5mm)
- 1 x HW-modification floppy
- 1 x installation instructions

Installation ex Works

The modification is installed ex works with the following machines:

Serial Number: 1233, 1234, 1235, 1236, 1238, 1239, 1240, 1241, \geq 1243

printed in Germany

